

ILS RWY 30

MERCED MUNI-MACREADEY FIELD (MCE)

LOC/DME I-MCE 109.3 Chan 30	APP CRS 303°	Rwy ldg 5903 TDZE 156 Apt Elev 156
---	------------------------	---

⚠ For inoperative MALS/R increase S-LOC 30 Cat D visibility to 1.
⚠ Circling not authorized northeast of Rwy 12-30.




MALS/R

MISSED APPROACH: Climb to 1000 then climbing left turn to 2000 direct HYP VOR/DME and hold.

ASOS
132.175

NORCAL APP CON
120.95 269.45

UNICOM
122.7 (CTAF) **⓪**

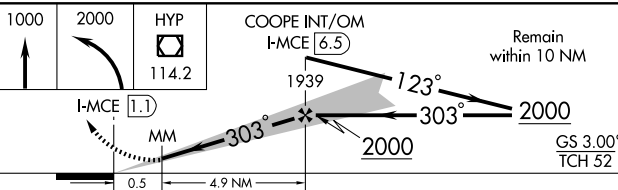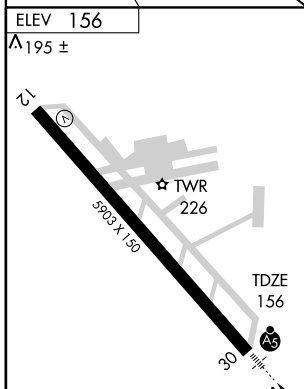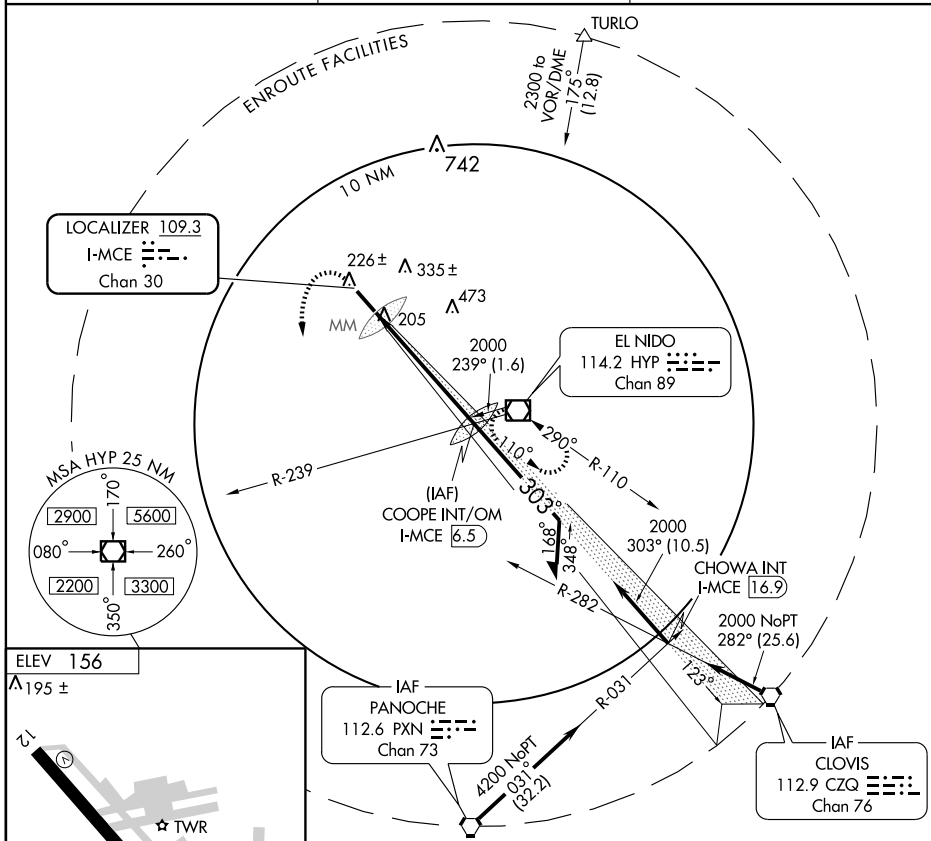

CATEGORY	A	B	C	D
S-ILS 30	356-½ 200 (200-½)			
S-LOC 30	480-½ 324 (400-½)			480-¾ 324 (400-¾)
CIRCLING	540-1 384 (400-1)	620-1 464 (500-1)	620-1½ 464 (500-1½)	720-2 564 (600-2)

SW-2, 16 MAR 2006 to 13 APR 2006

SW-2, 16 MAR 2006 to 13 APR 2006